



Field Bulletin

Tuesday, February 08, 2005

V3 GP Gate Issue

Ref: UKE022

Issue

Inability to power and test V3 (Razr) on Wingate.

Problem

During the initial launch period of V3 we have discovered some Gate systems require modification to allow testing of V3 phones.

Field Service Action


A modification may be required to the EMMI box wiring to allow the V3 to power up using GP Gate.

To establish if the modification is needed check the following, looking at the front of the EMMI Box 50 Pin connector.

Turn off power and disconnect all leads to the EMMI

Check Pins 11 and 15/16 are short.

Check Pins 49 and 2/3 are short.

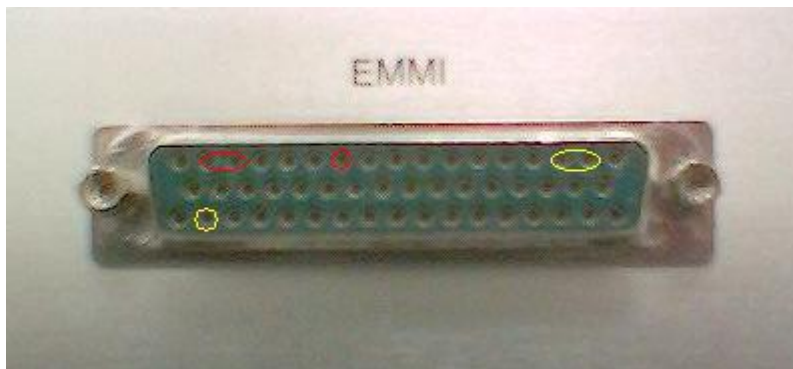

Motorola Confidential Propriety



If these are found to be open circuit then carry out the following modification:

Open the EMMI / Junior Box Casing and identify the connections detailed in Fig1. Make the shorts between the pins and re-assemble the box. You should now be able to interface to V3 Phones by using GPGate.

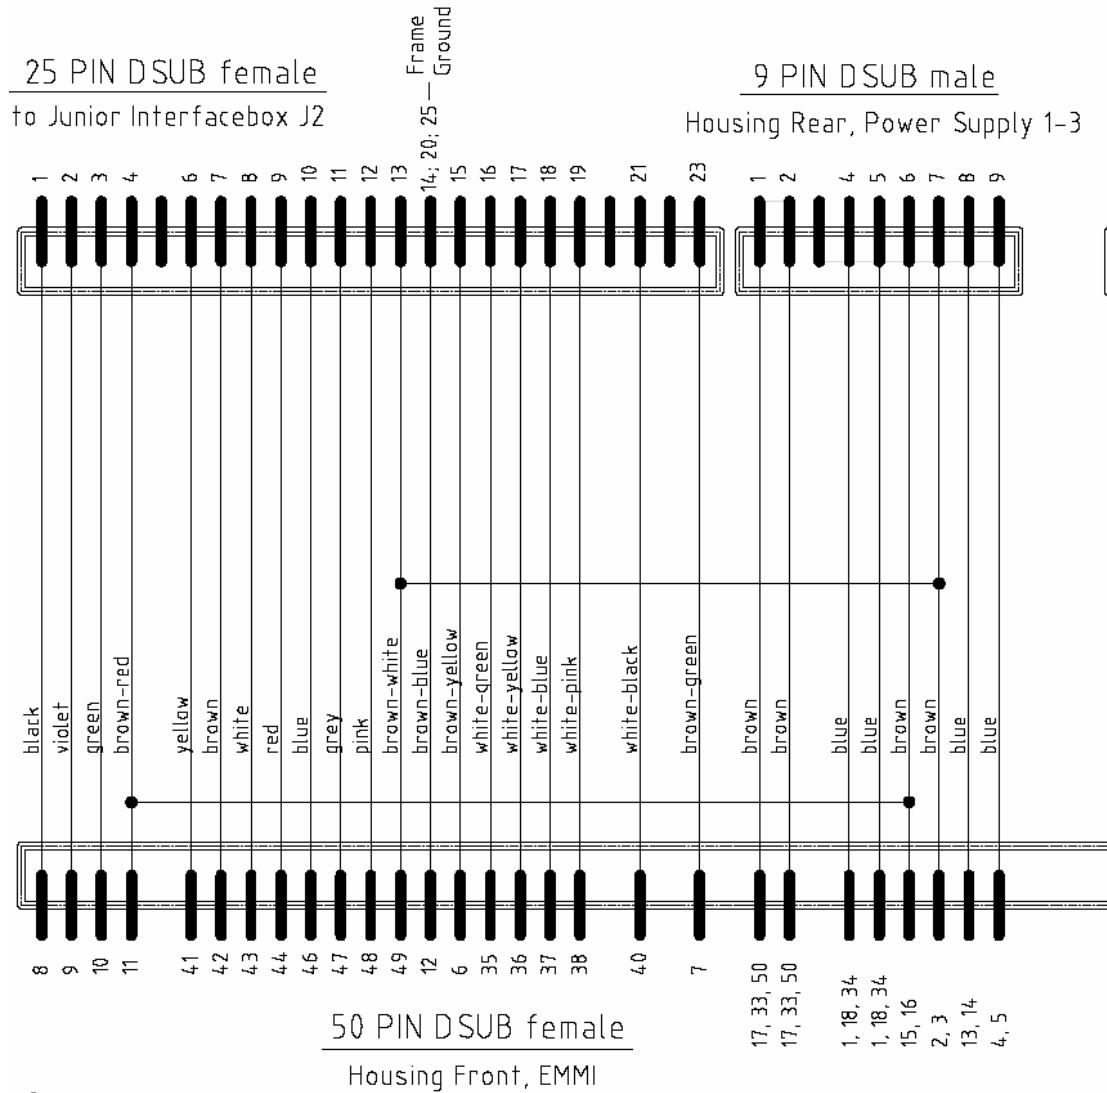


Fig 1.

If you experience problems carrying out this modification please email :

markgillan@motorola.com