

Technical Bulletin


Bulletin No: 1007
Issue Date: 26/08/2003
Product: GX10i

Broken Diode D311

Diode D311 has been changed in the manufacturing process.

The modified diode is more resilient to the initial surge and will reduce the occurrence of the diode blowing during normal operation.

The old diode, Part Number VHERSB6R8S+-1L should no longer be used, the new diode Part Number VHD1SS388/-1 must be used instead.

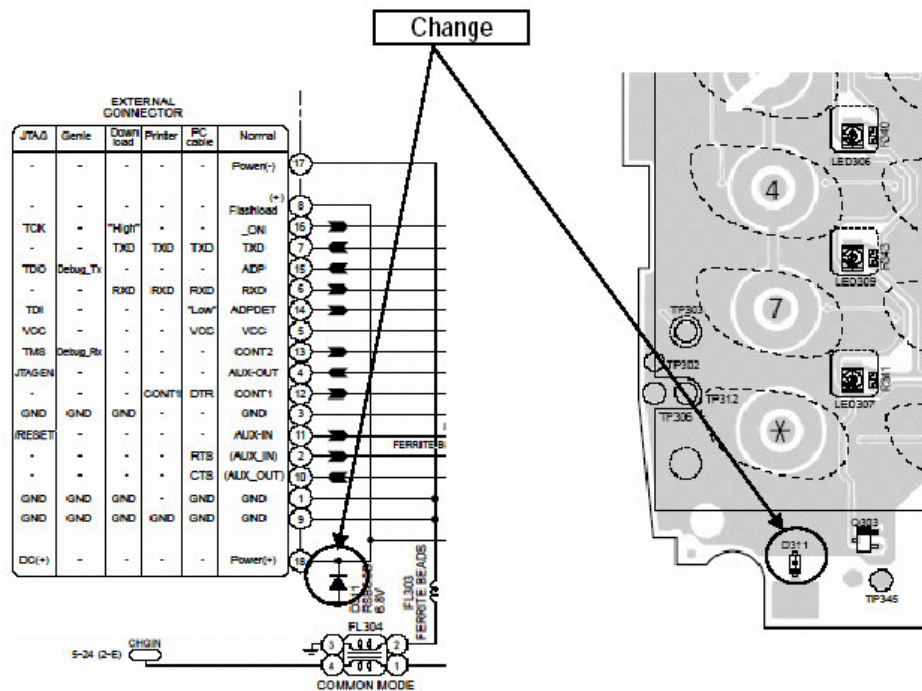

It is not necessary to replace the diode unless it is found to be faulty.