
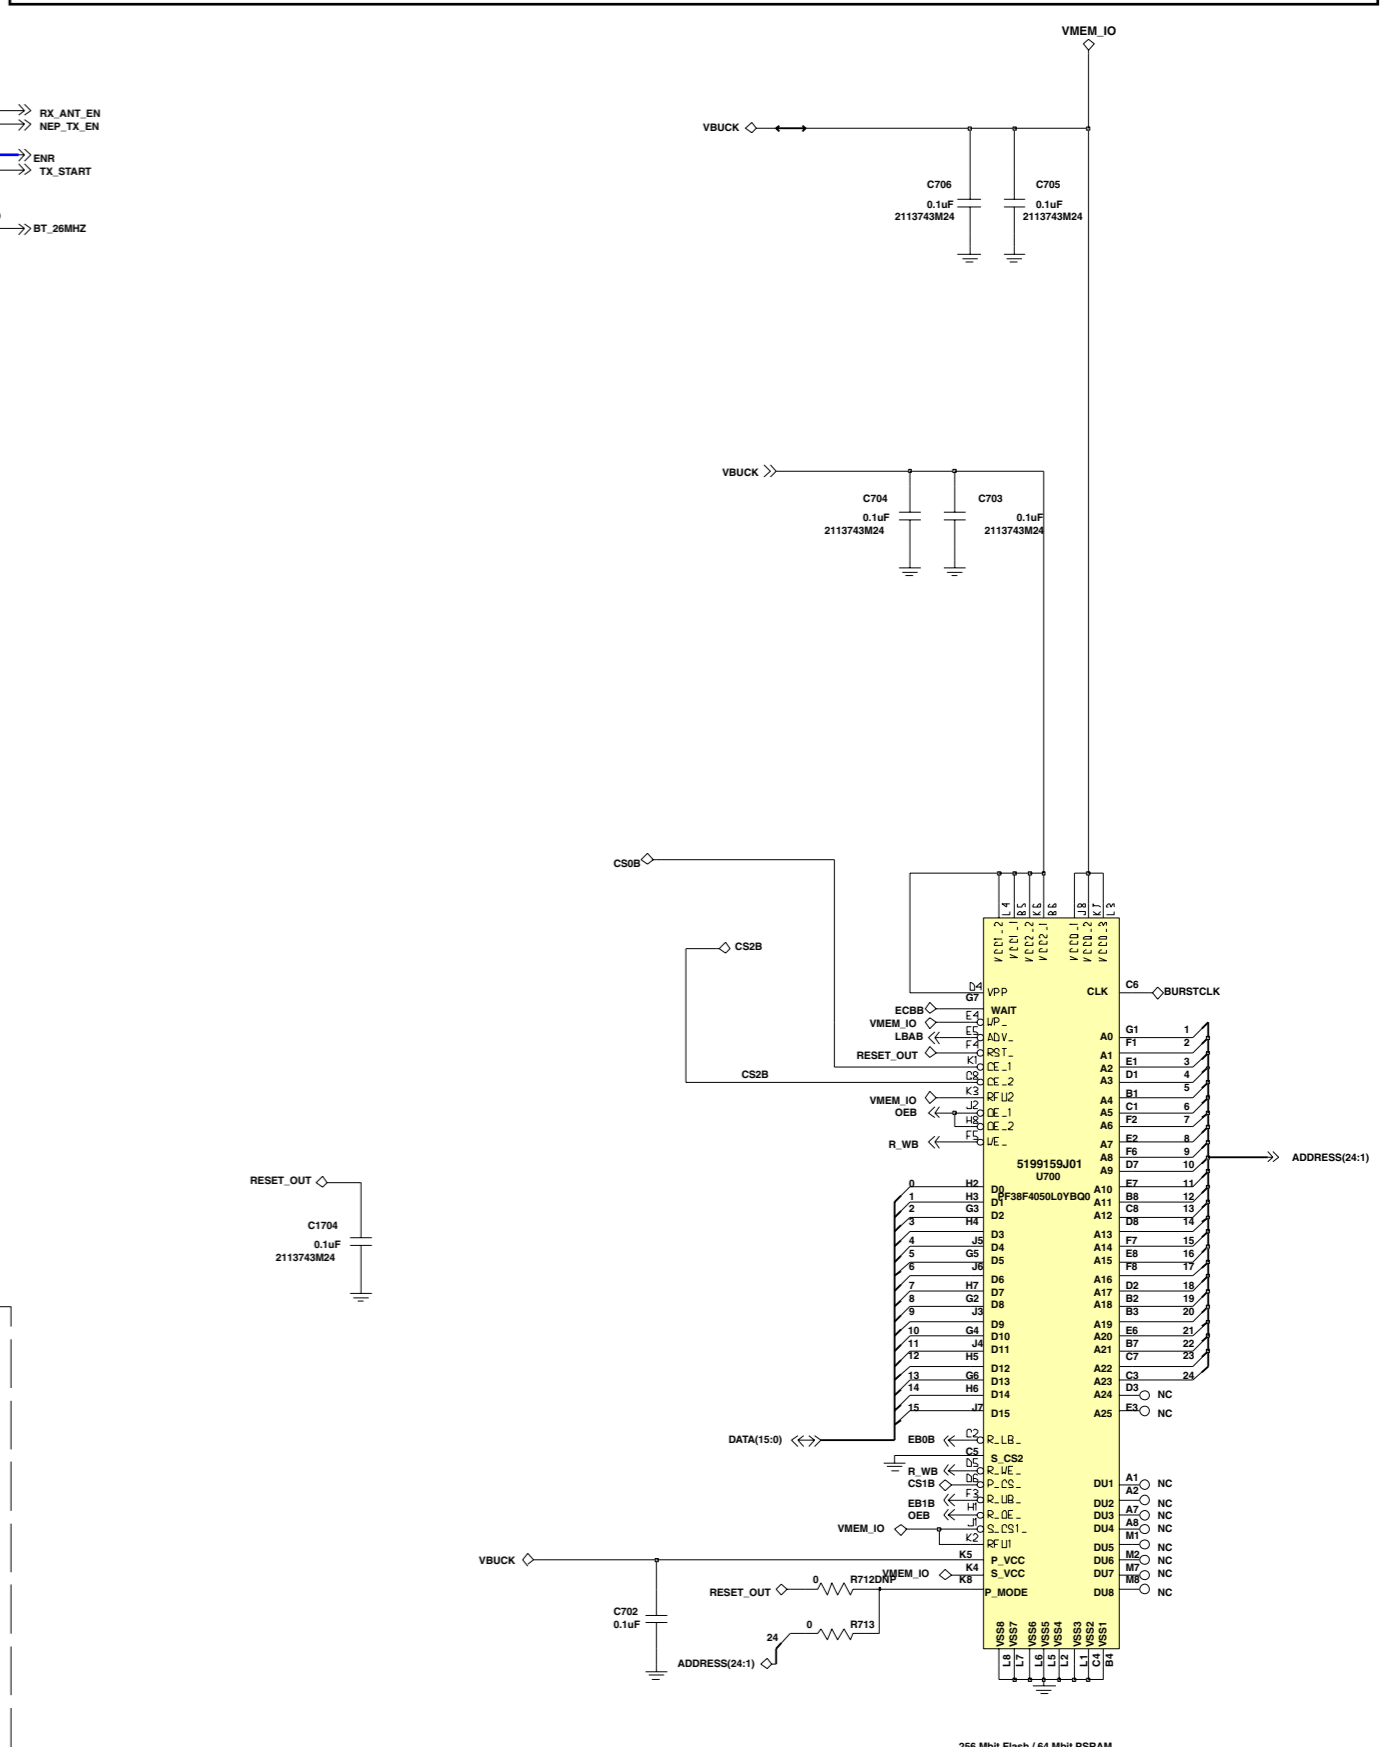
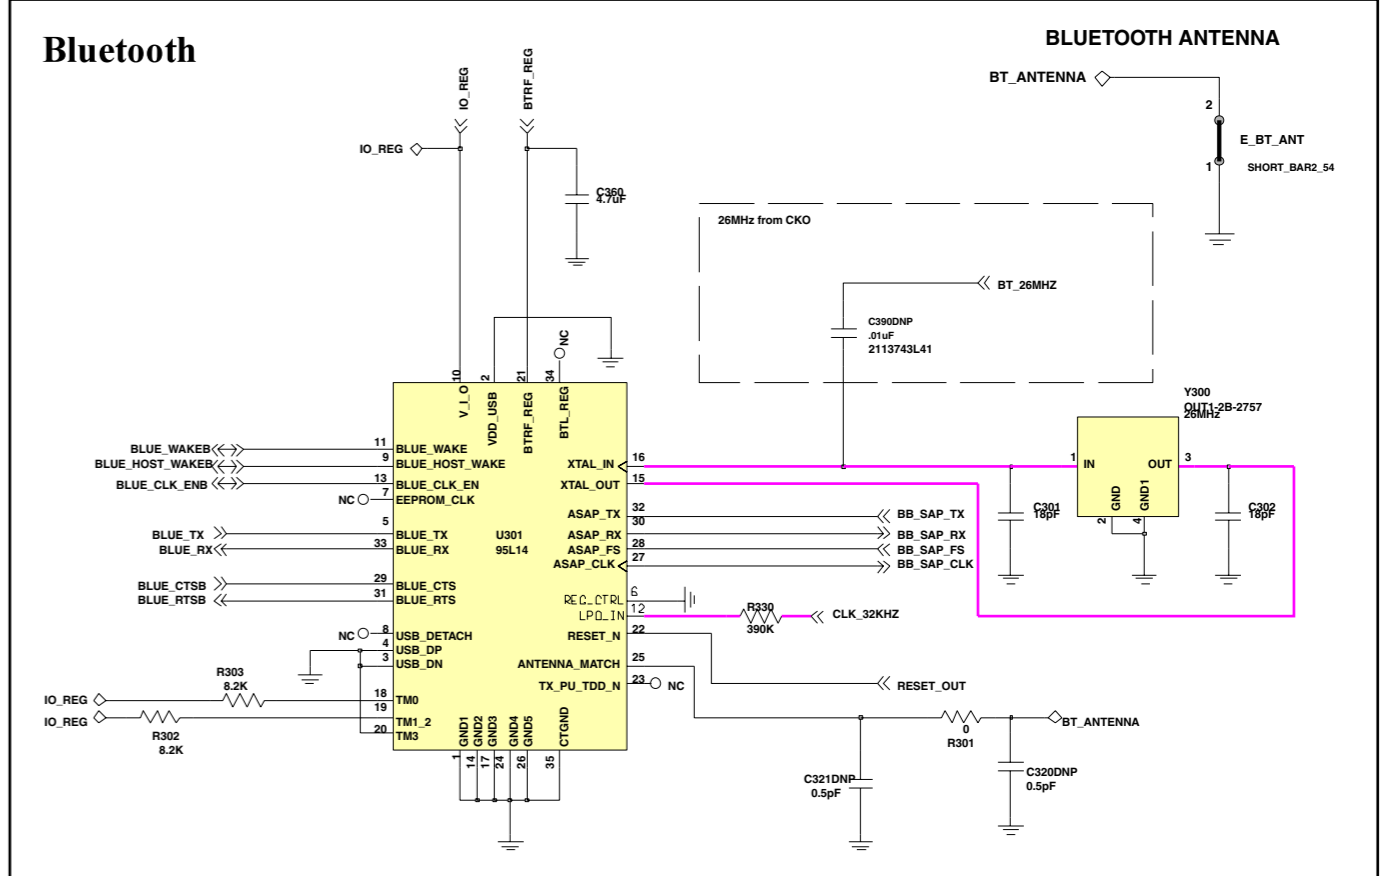



MOTOROLA CONFIDENTIAL PROPRIETARY
BASEBAND PROCESSOR

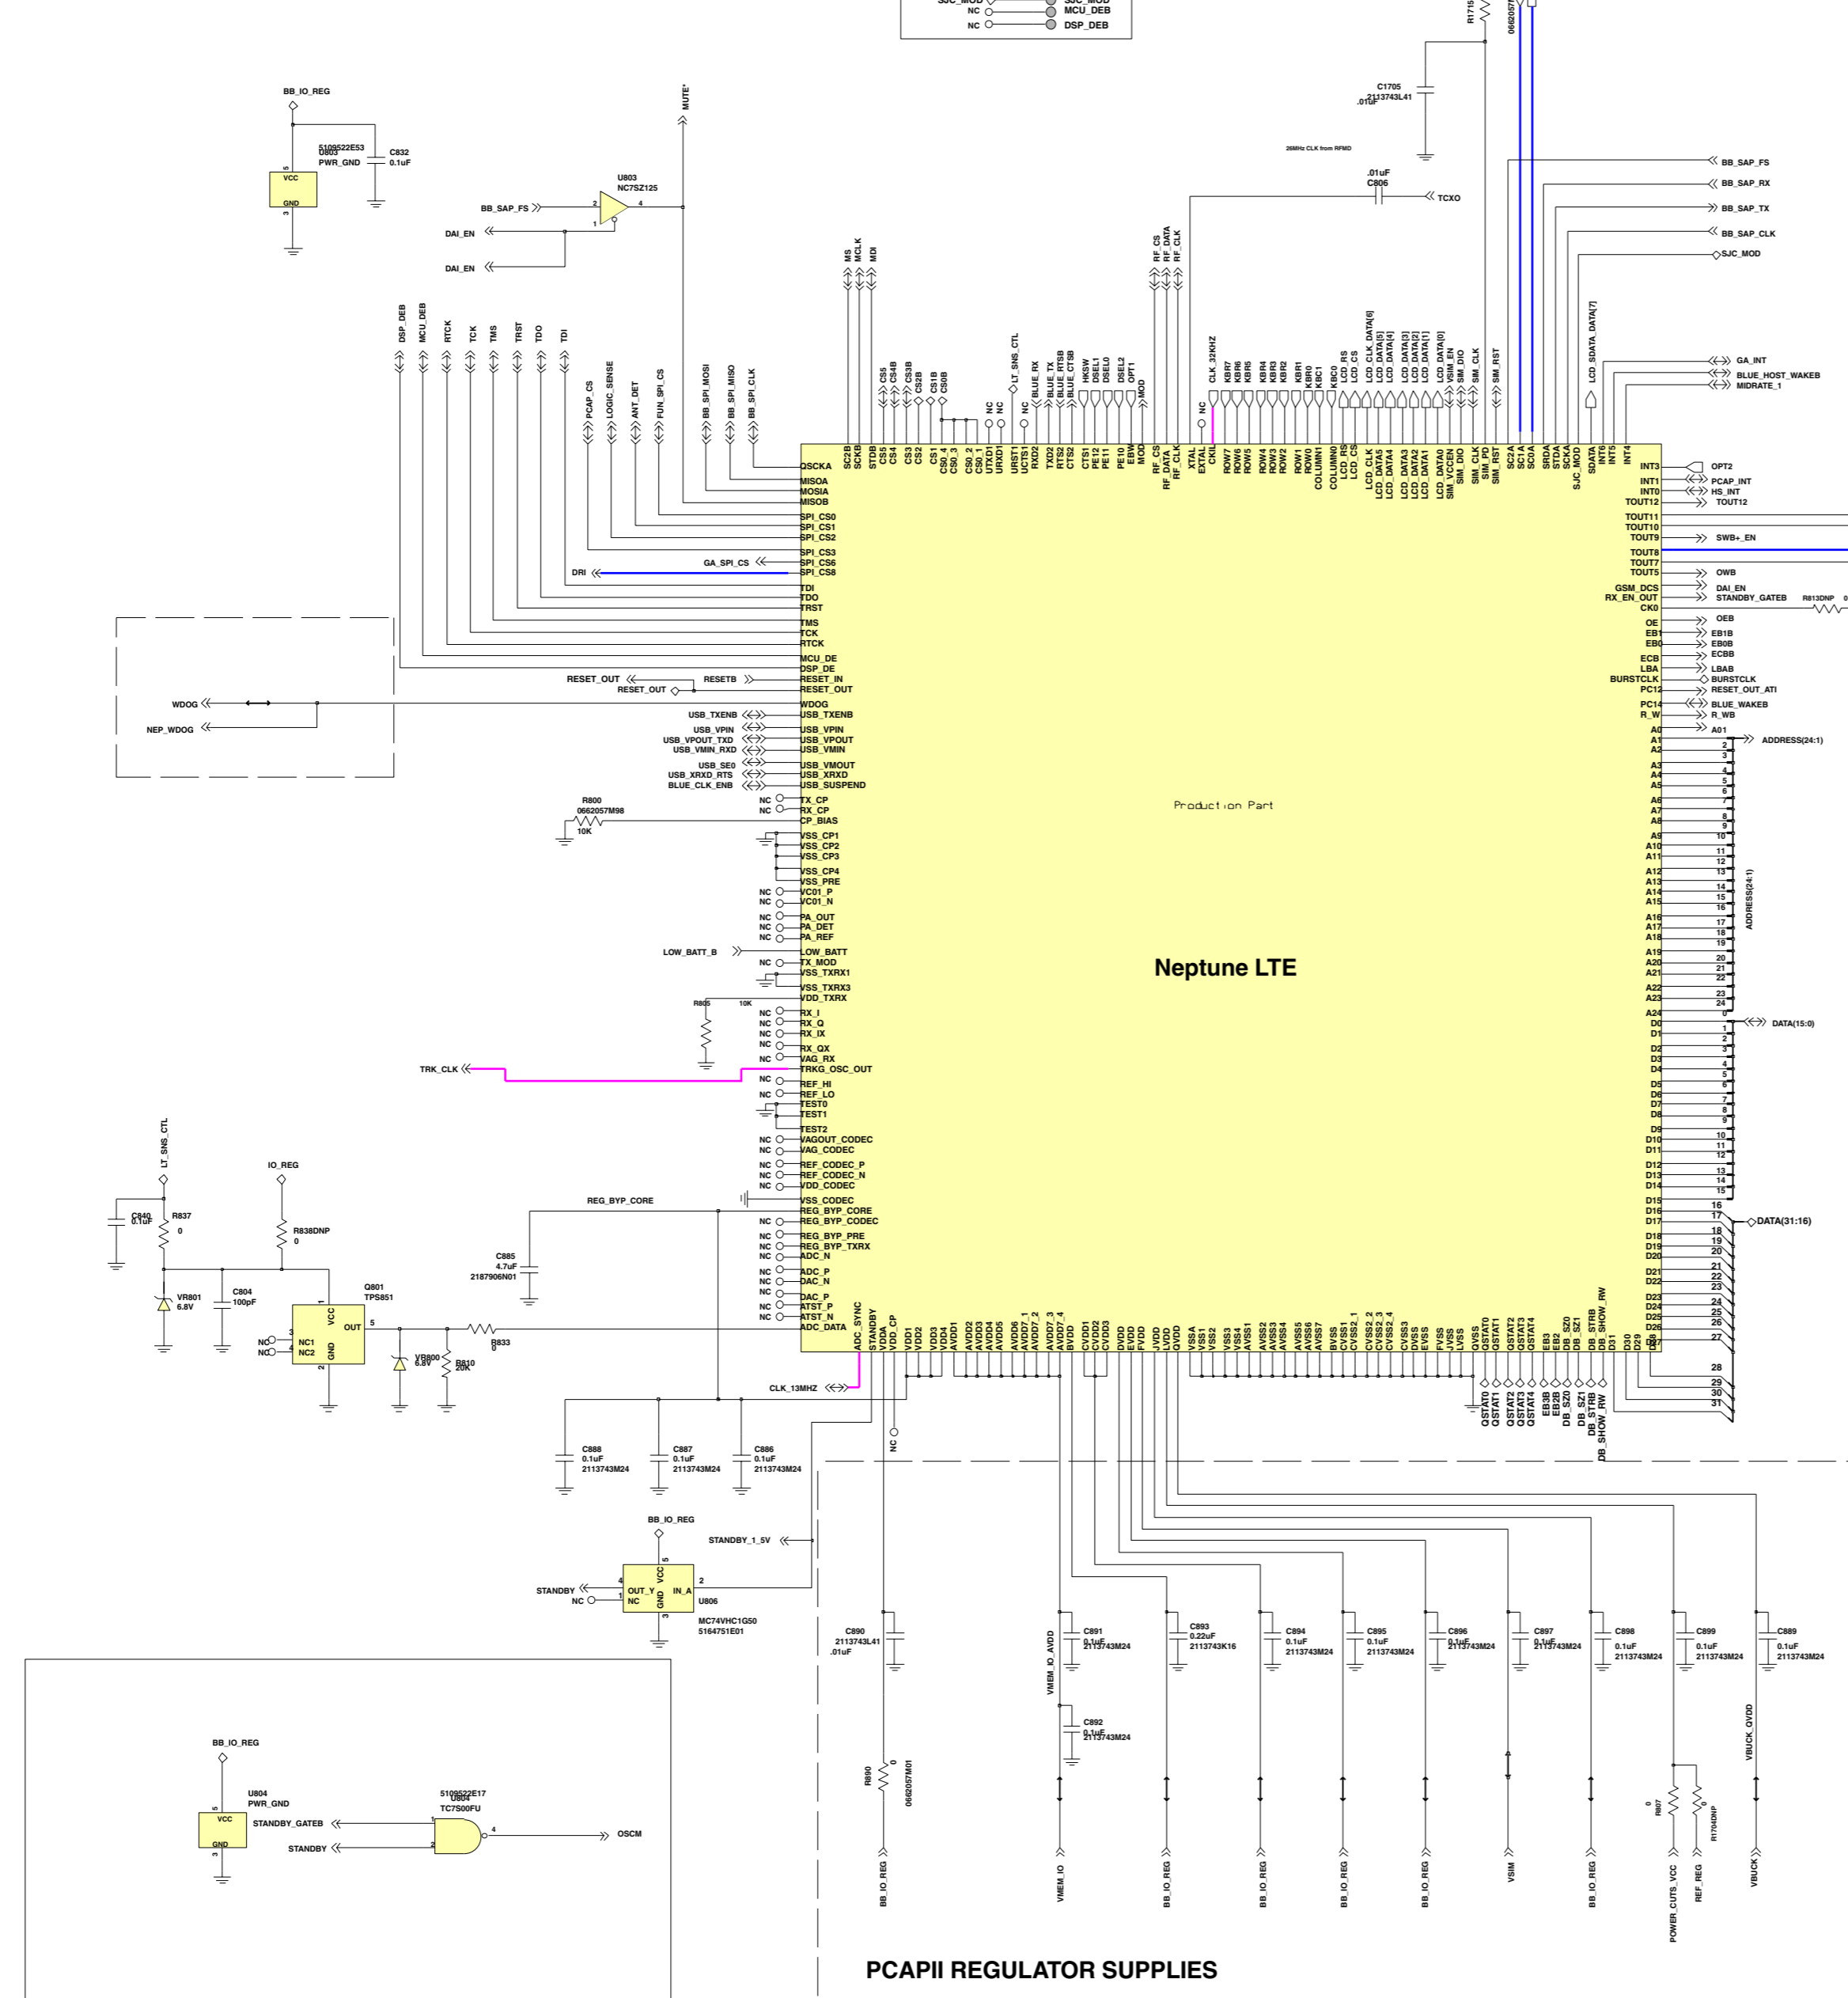


V635

Service Engineering
& Optimization
Level 3 Authorized


GSM SERVICE SUPPORT GROUP	2004.11.26
Level 3 Schematics	Rev. 1.0
V635	8488789V_01_P3C
Alexander Buehler, Michael Hansen	Page 1 of 5

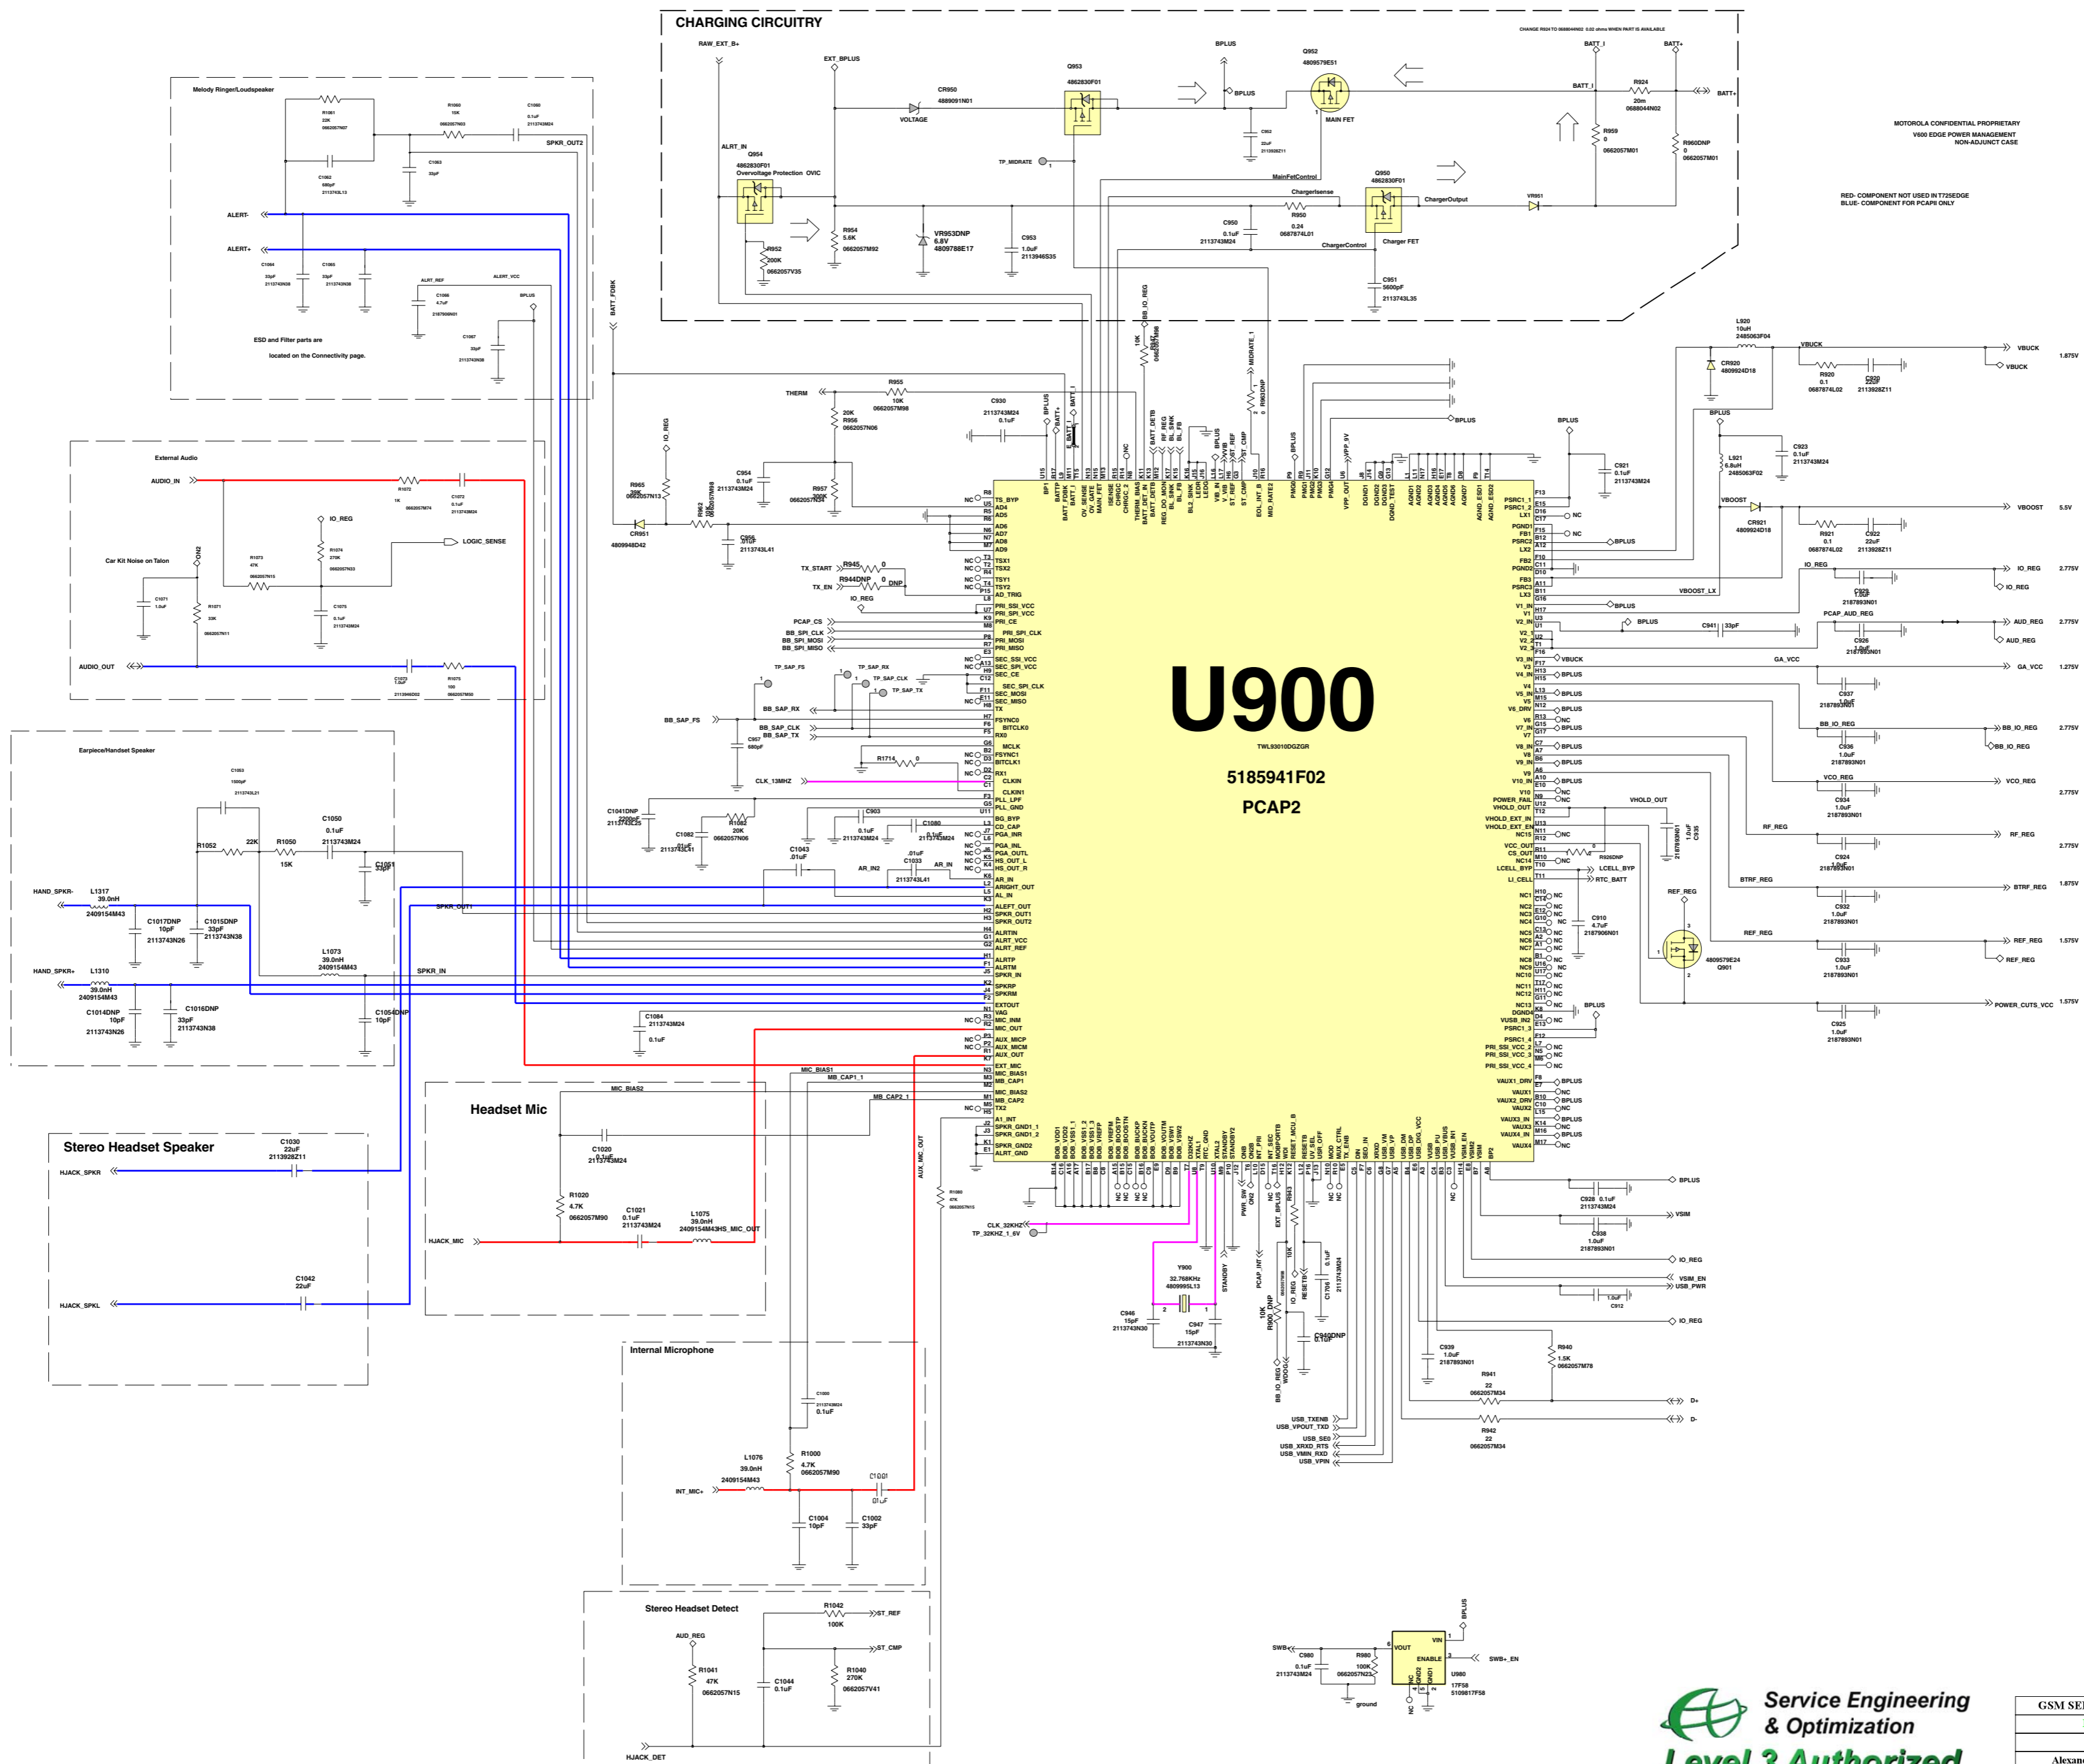


MOTOROLA CONFIDENTIAL PROPRIETARY
CONNECTIVITY

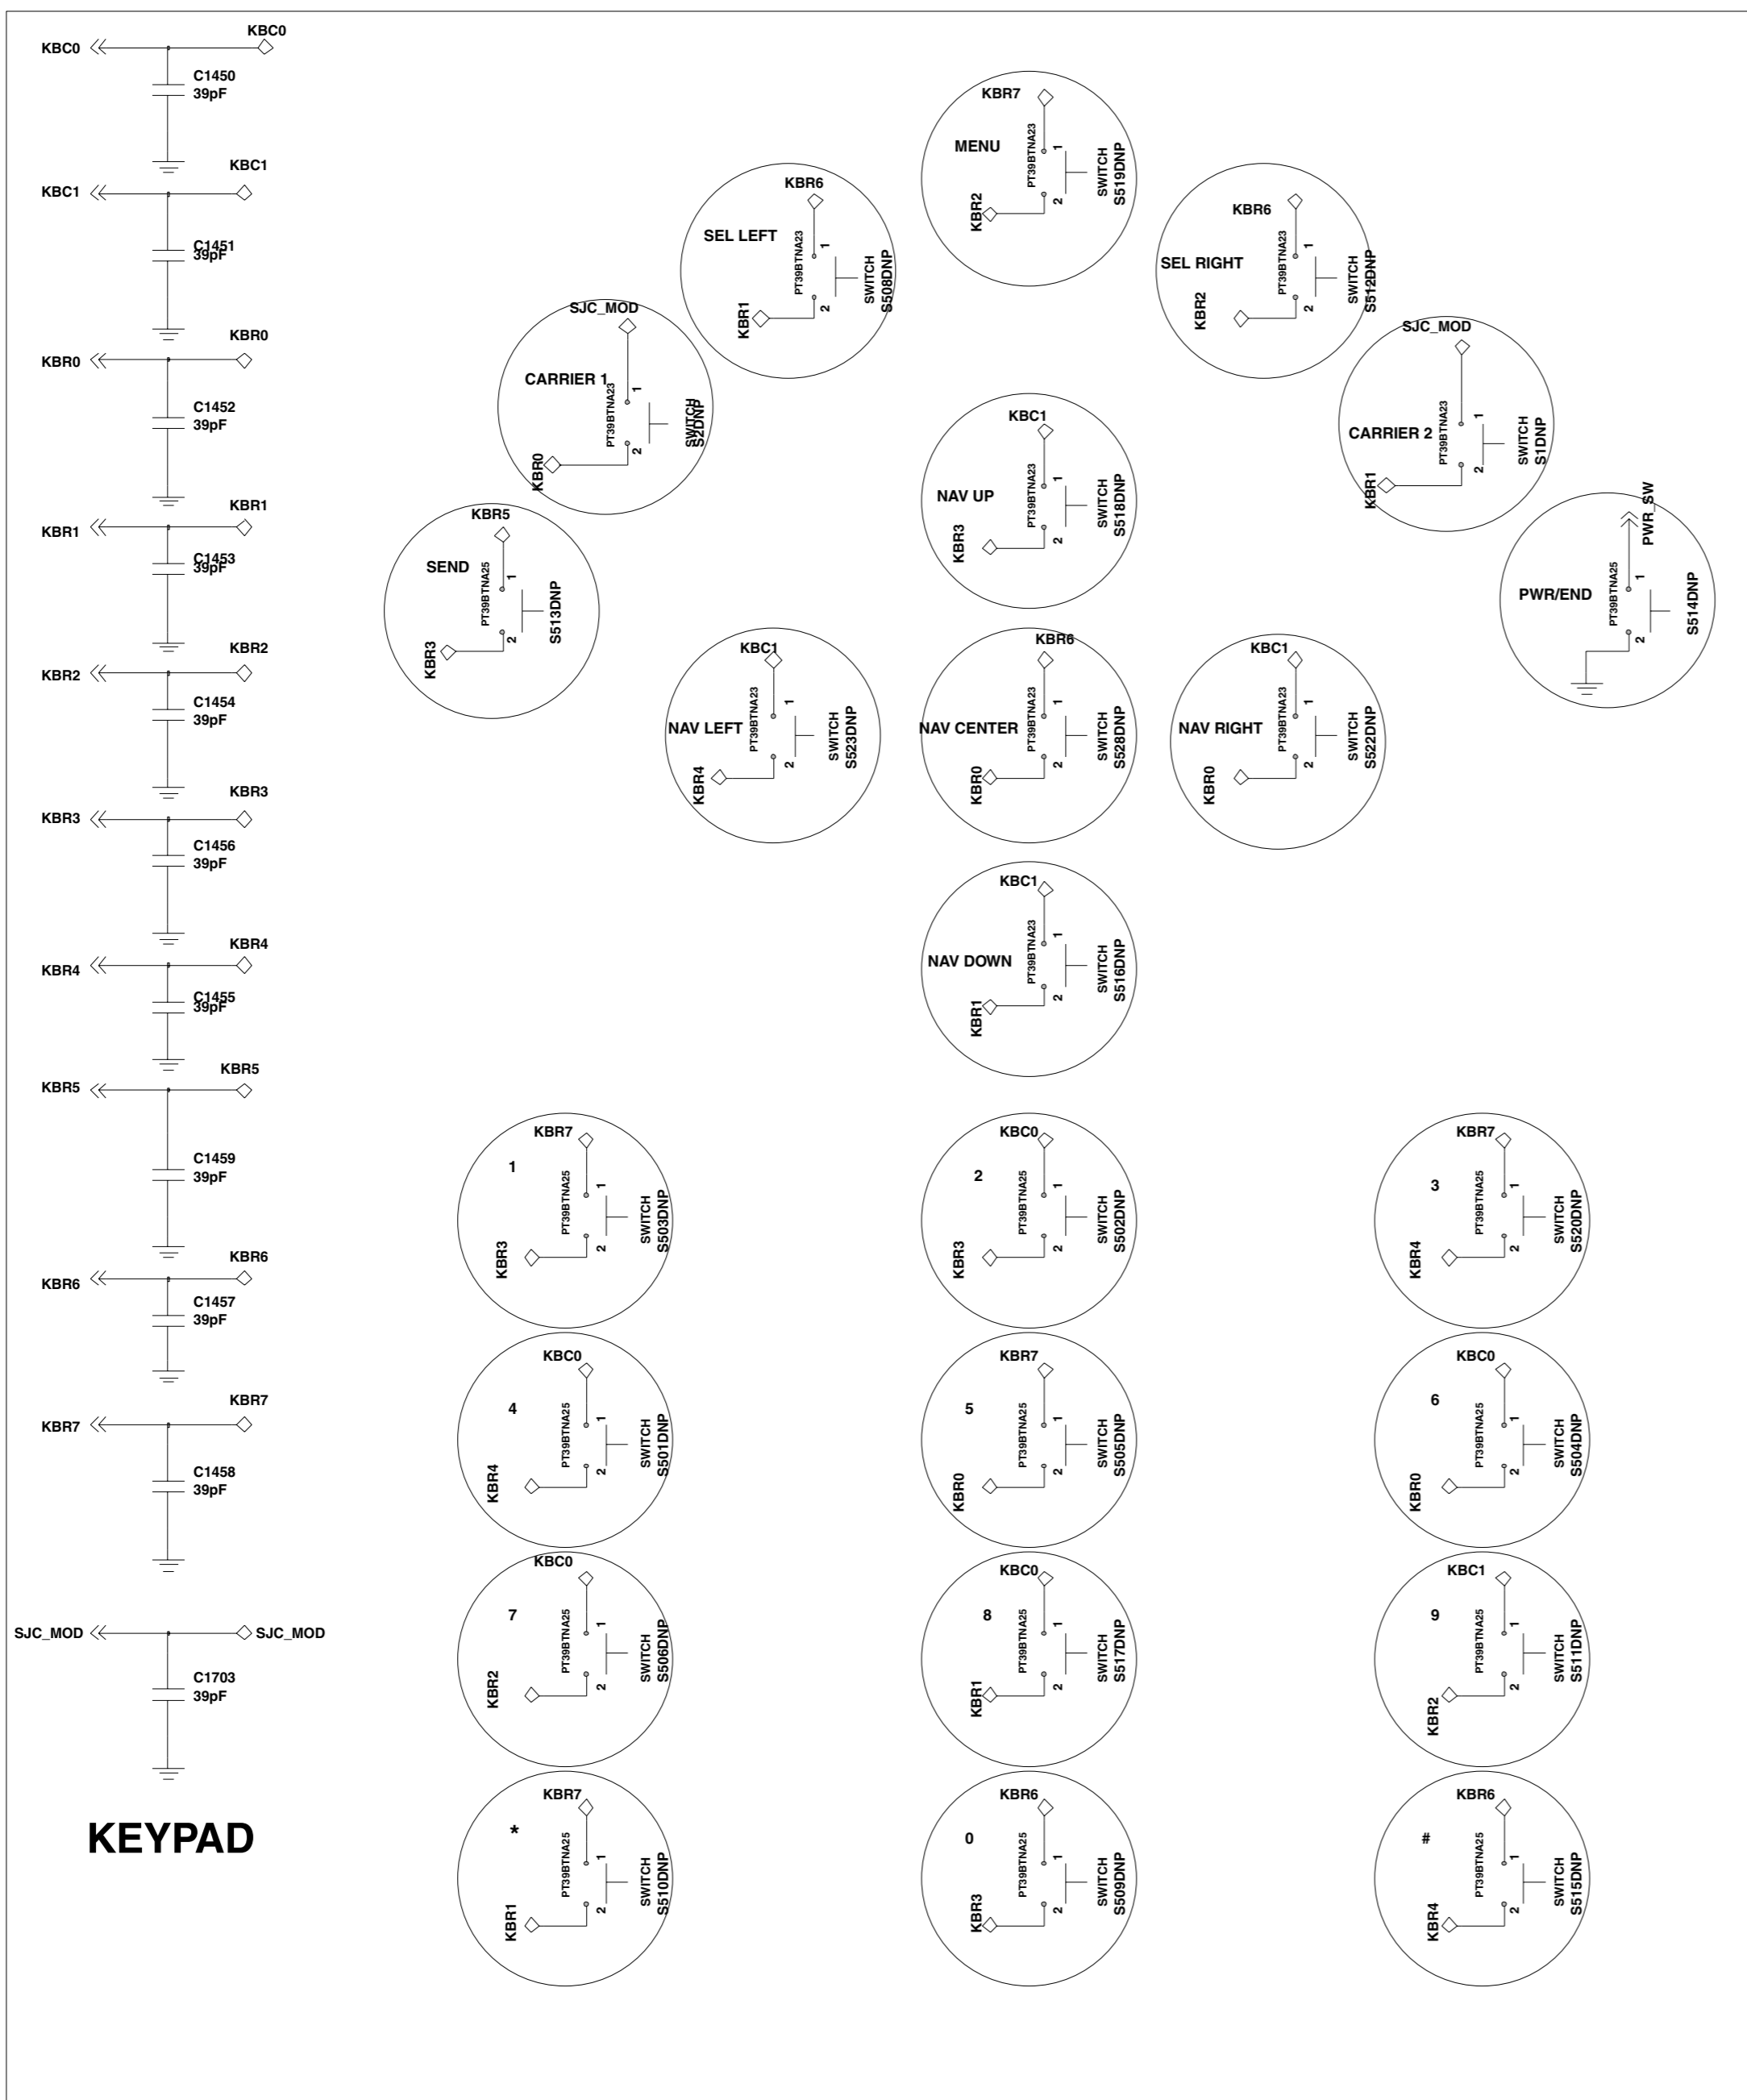


KEYPAD

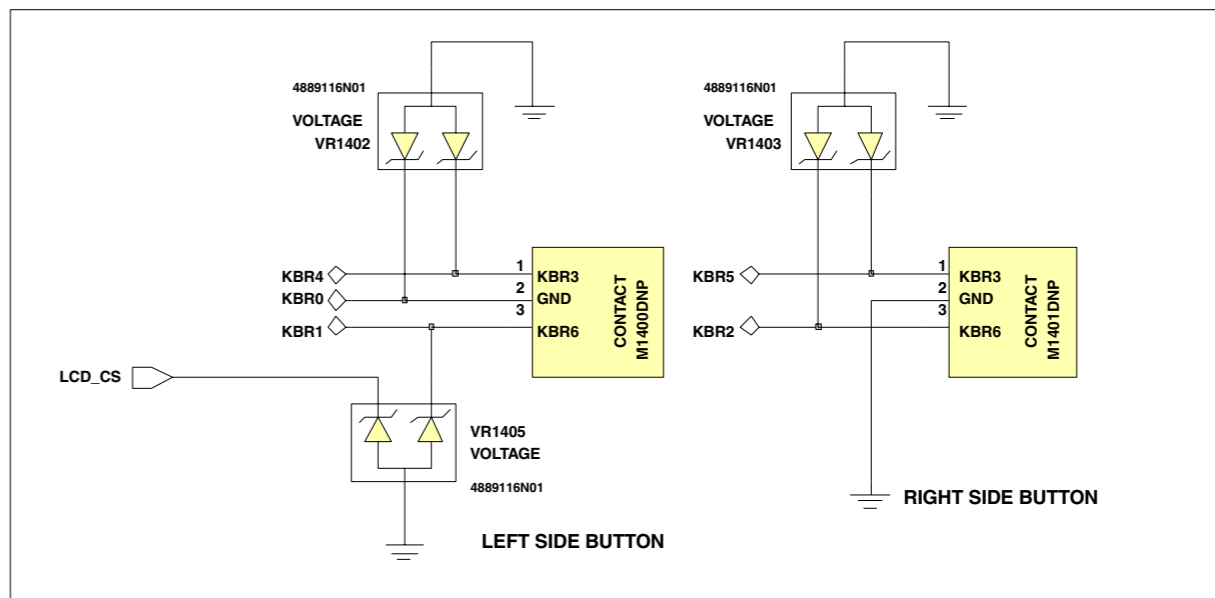


SIDE KEYS

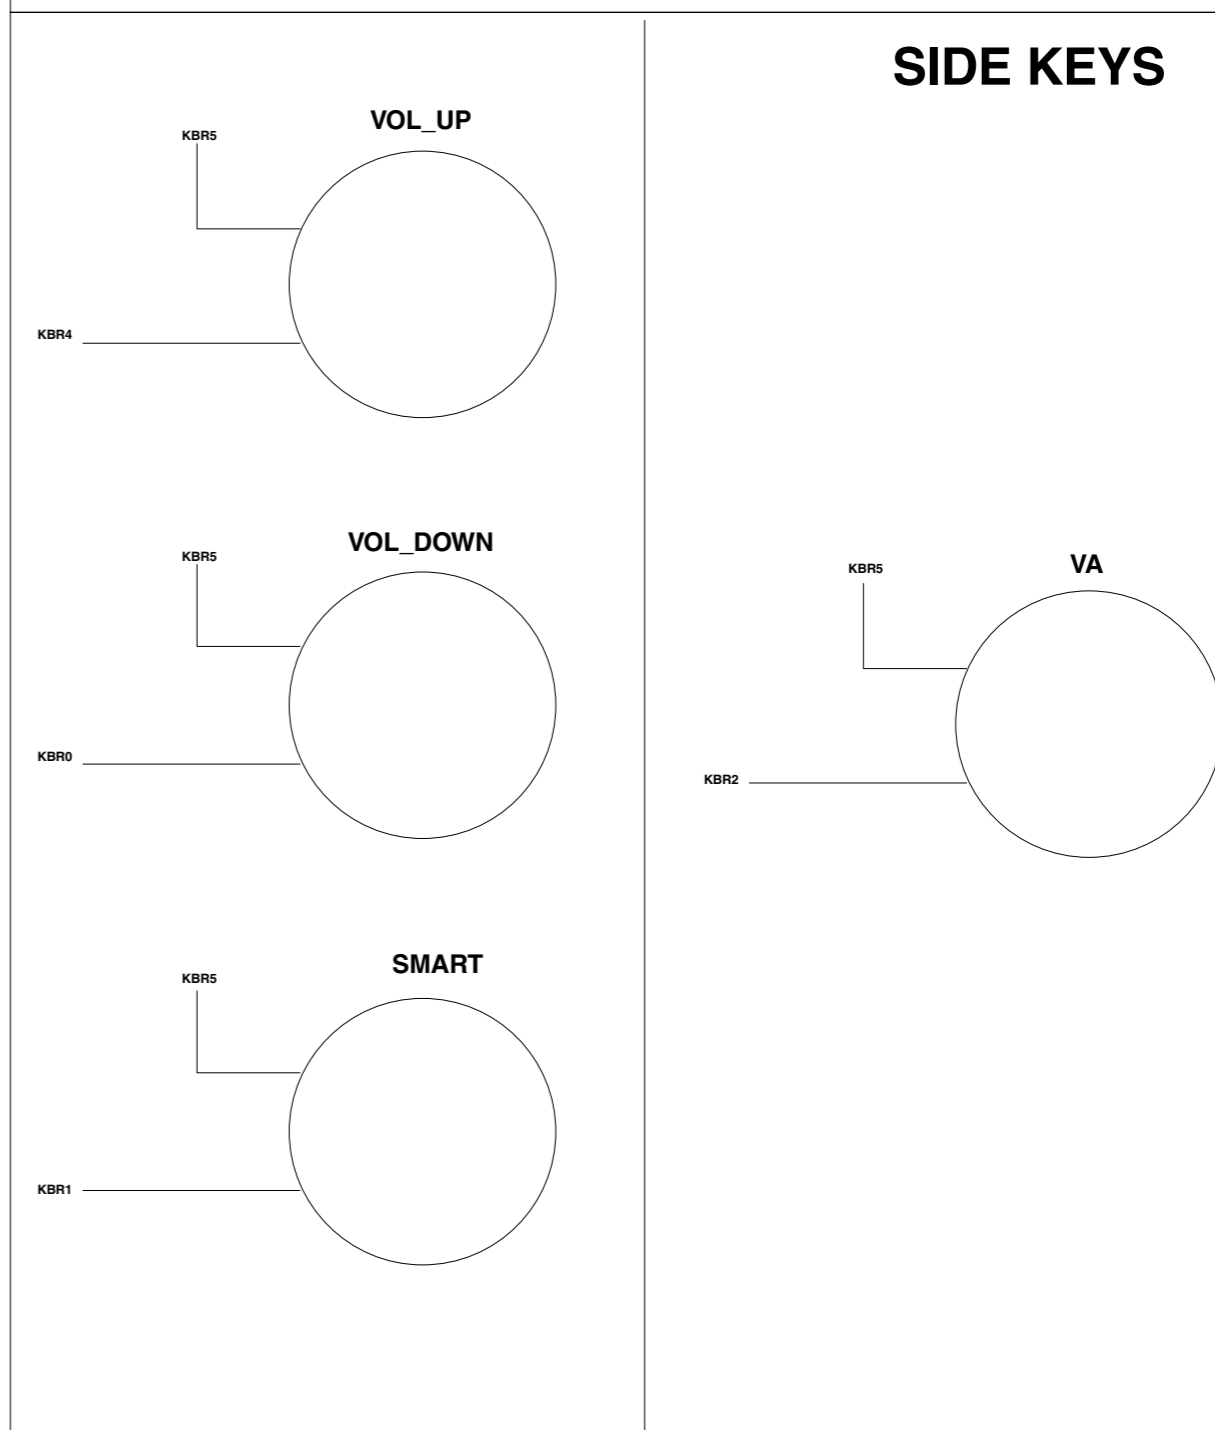



Mylar GND connections for ESD

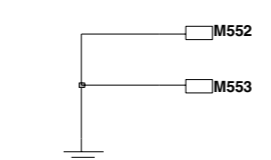


V600 DISPLAY CONNECTOR

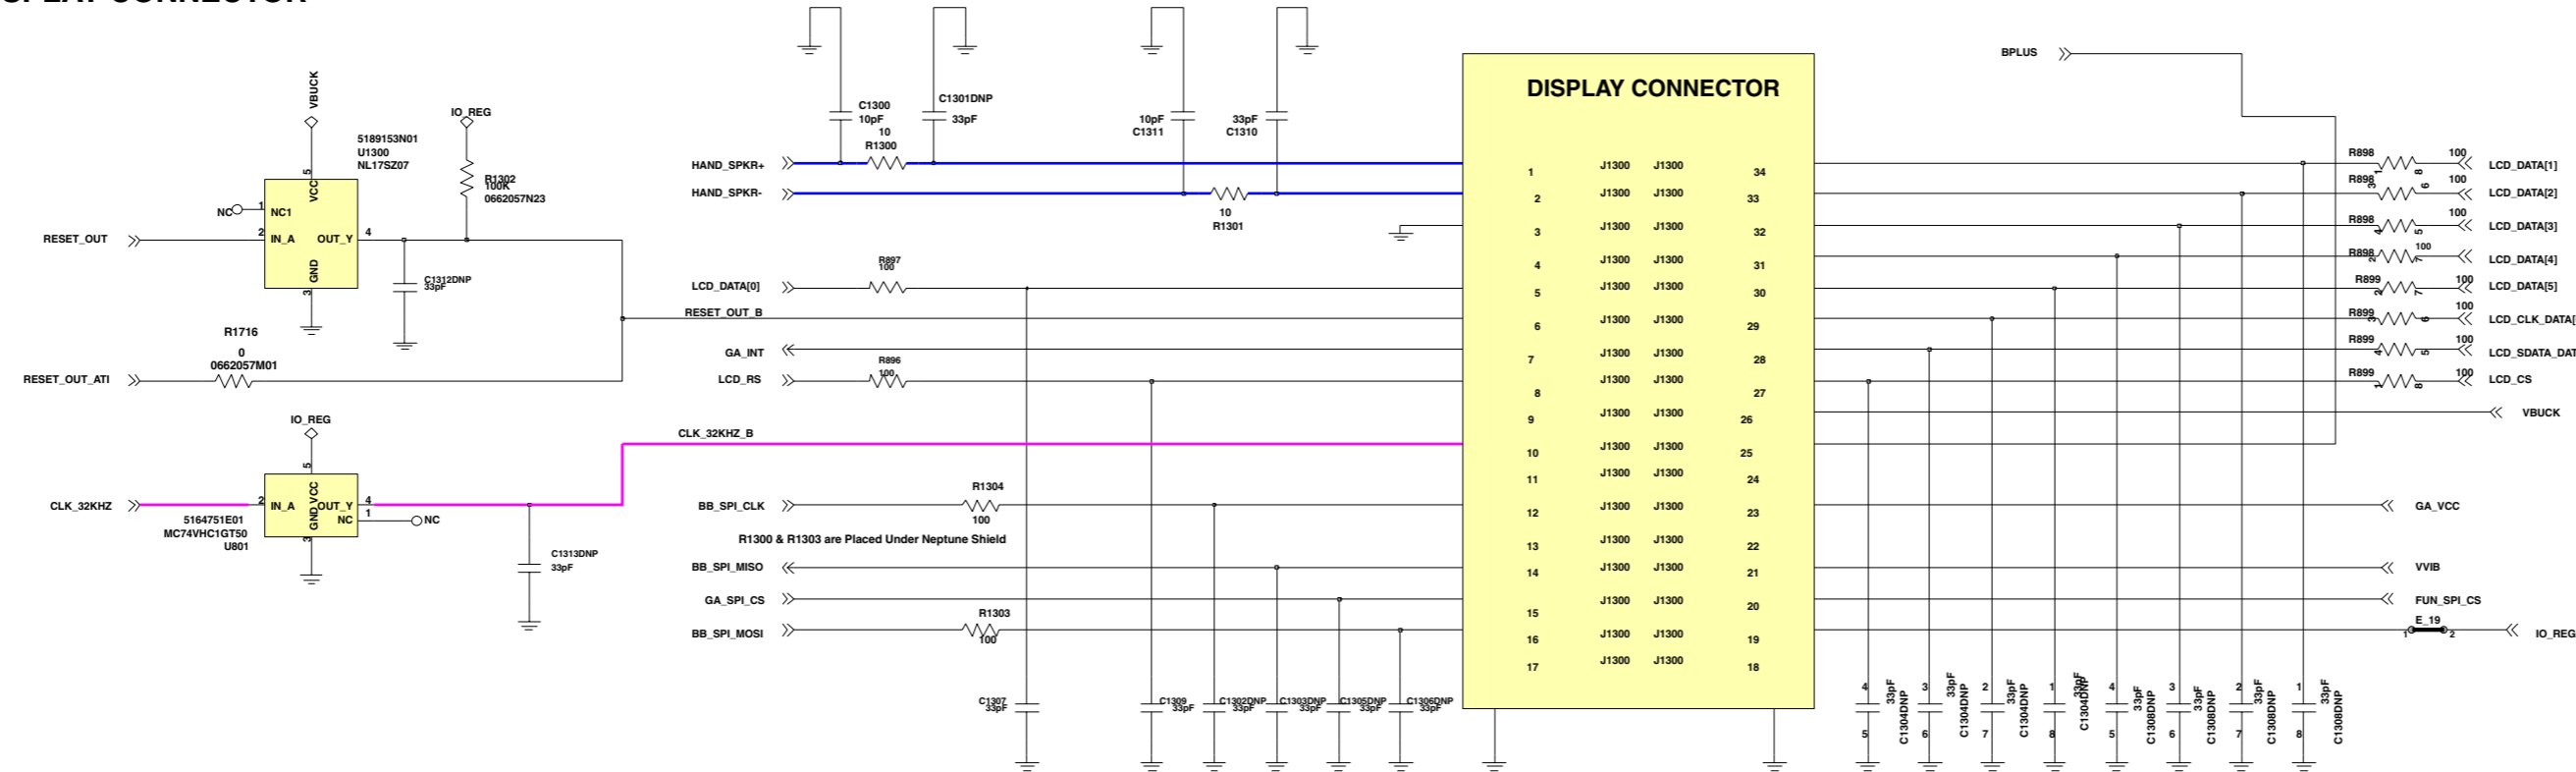


Stereo Headset Jack

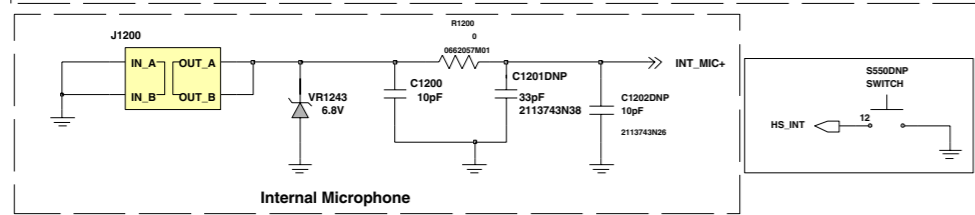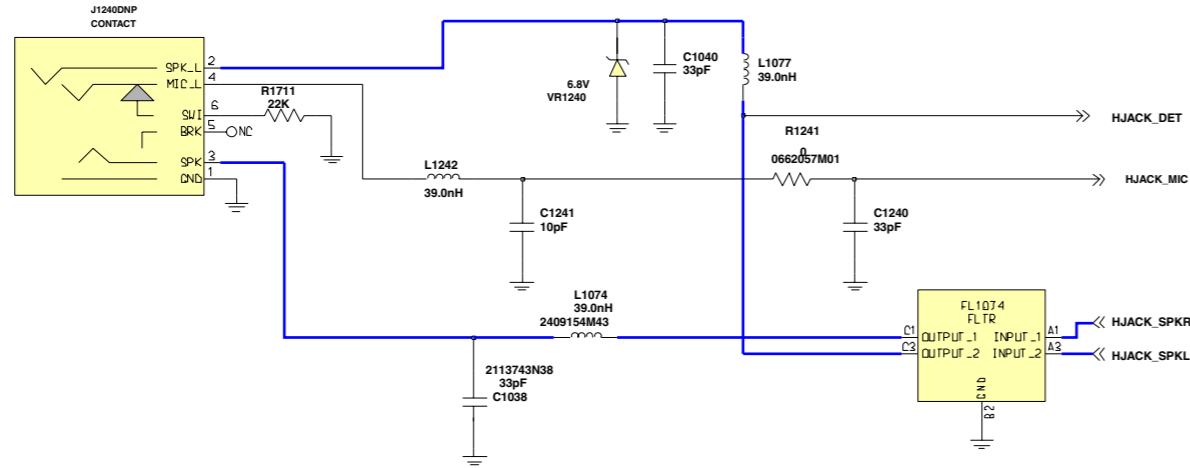



SIM BLOCK

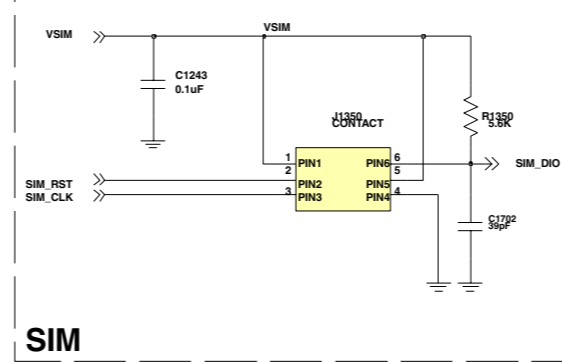


RTC Battery Connector

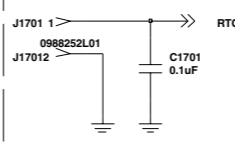

SIM

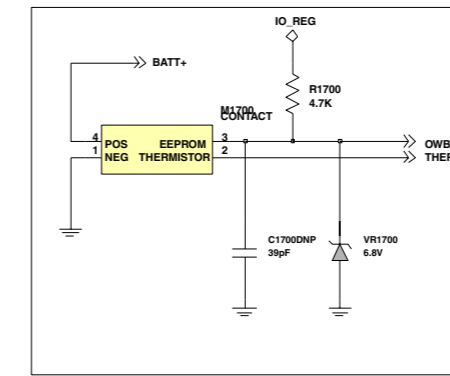
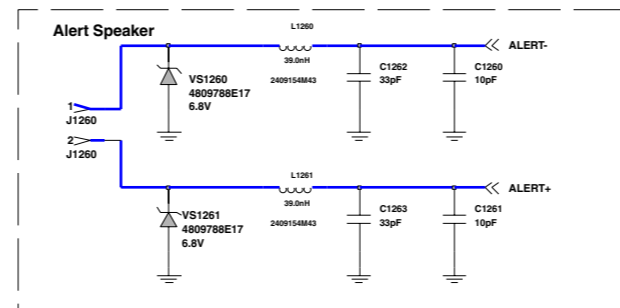


Accessory Connector CE Connector (0987636K06)

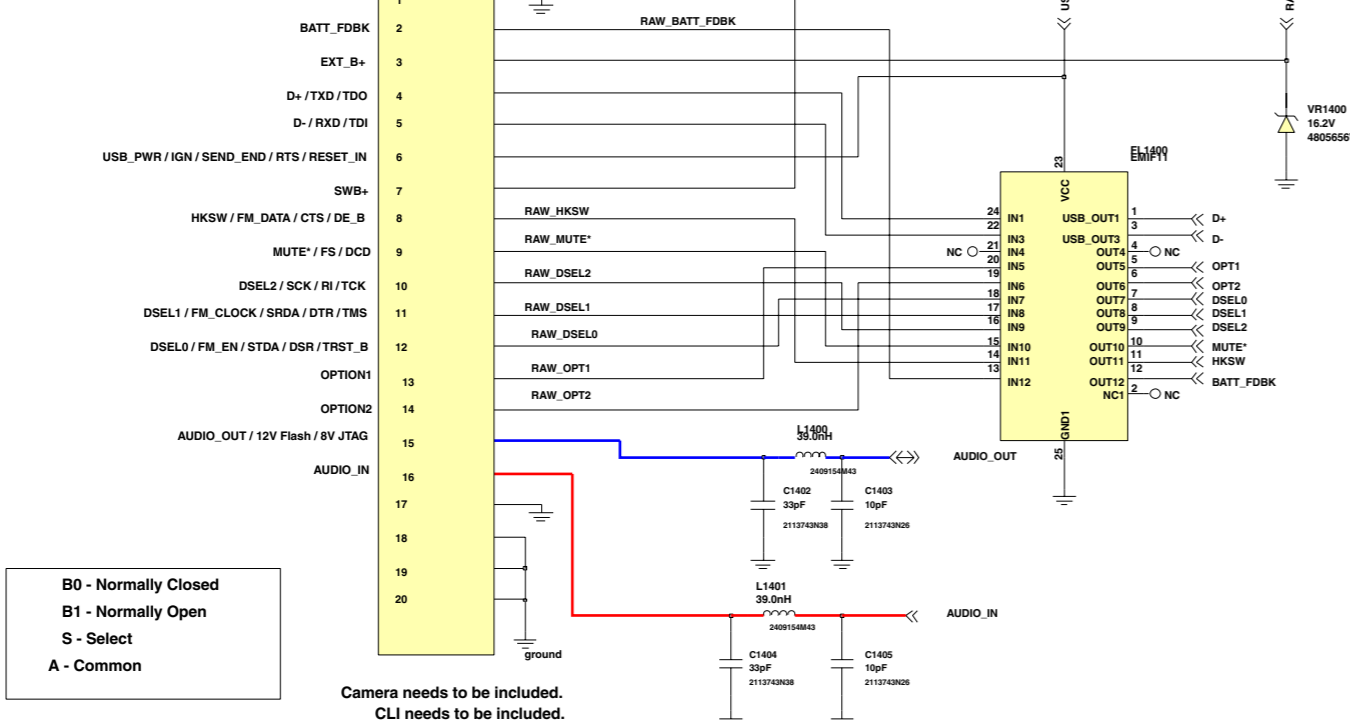

B0 - Normally Closed
B1 - Normally Open
S - Select
A - Common




Camera needs to be included.
CLI needs to be included.

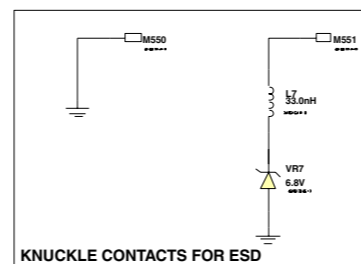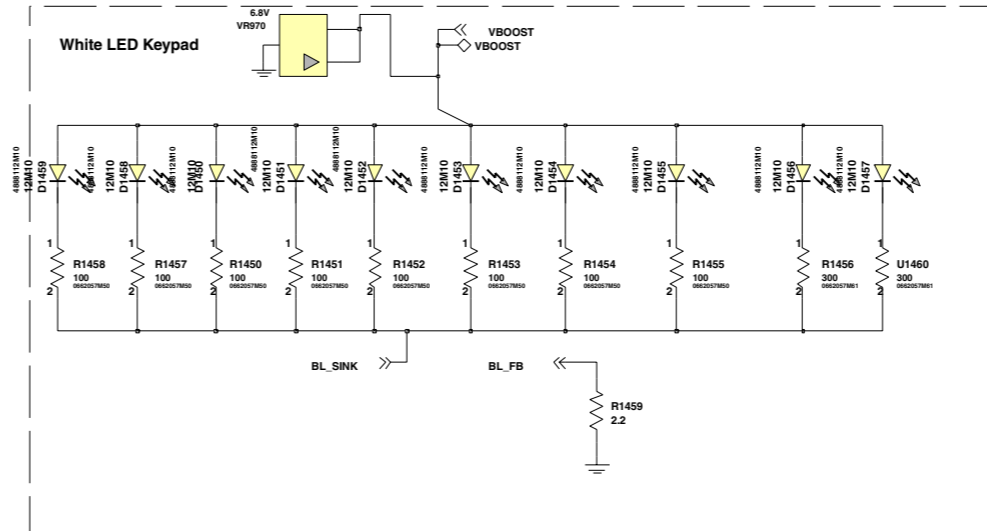

V635

Service Engineering & Optimization
Level 3 Authorized

GSM SERVICE SUPPORT GROUP	2004.11.26
Level 3 Schematics	Rev. 1.0
V635	8488789Y01_P3C
Alexander Buehler, Michael Hansen	Page 4 of 5

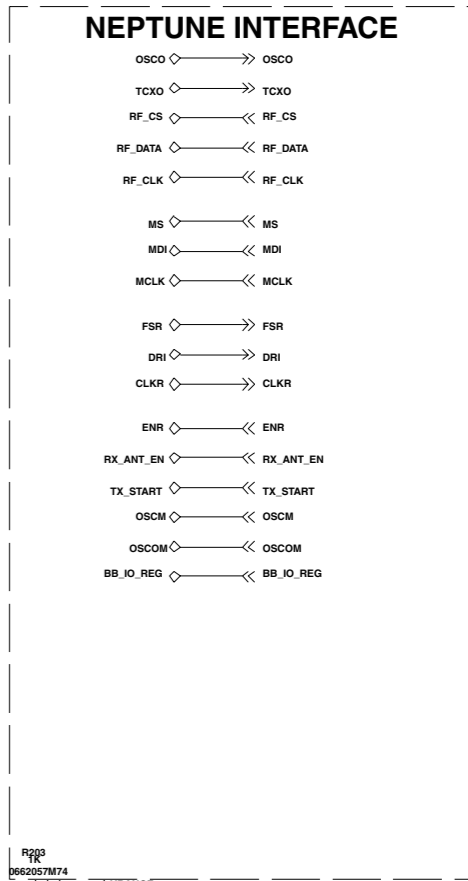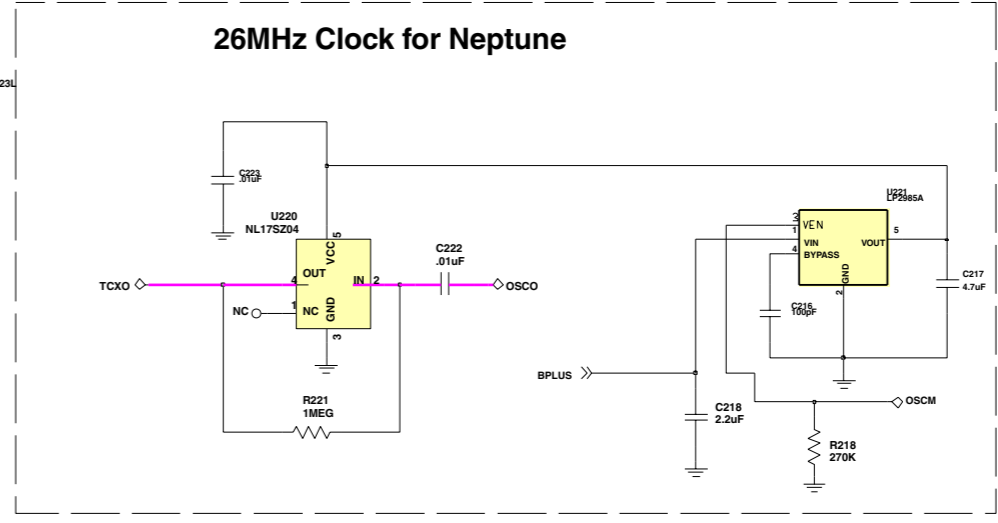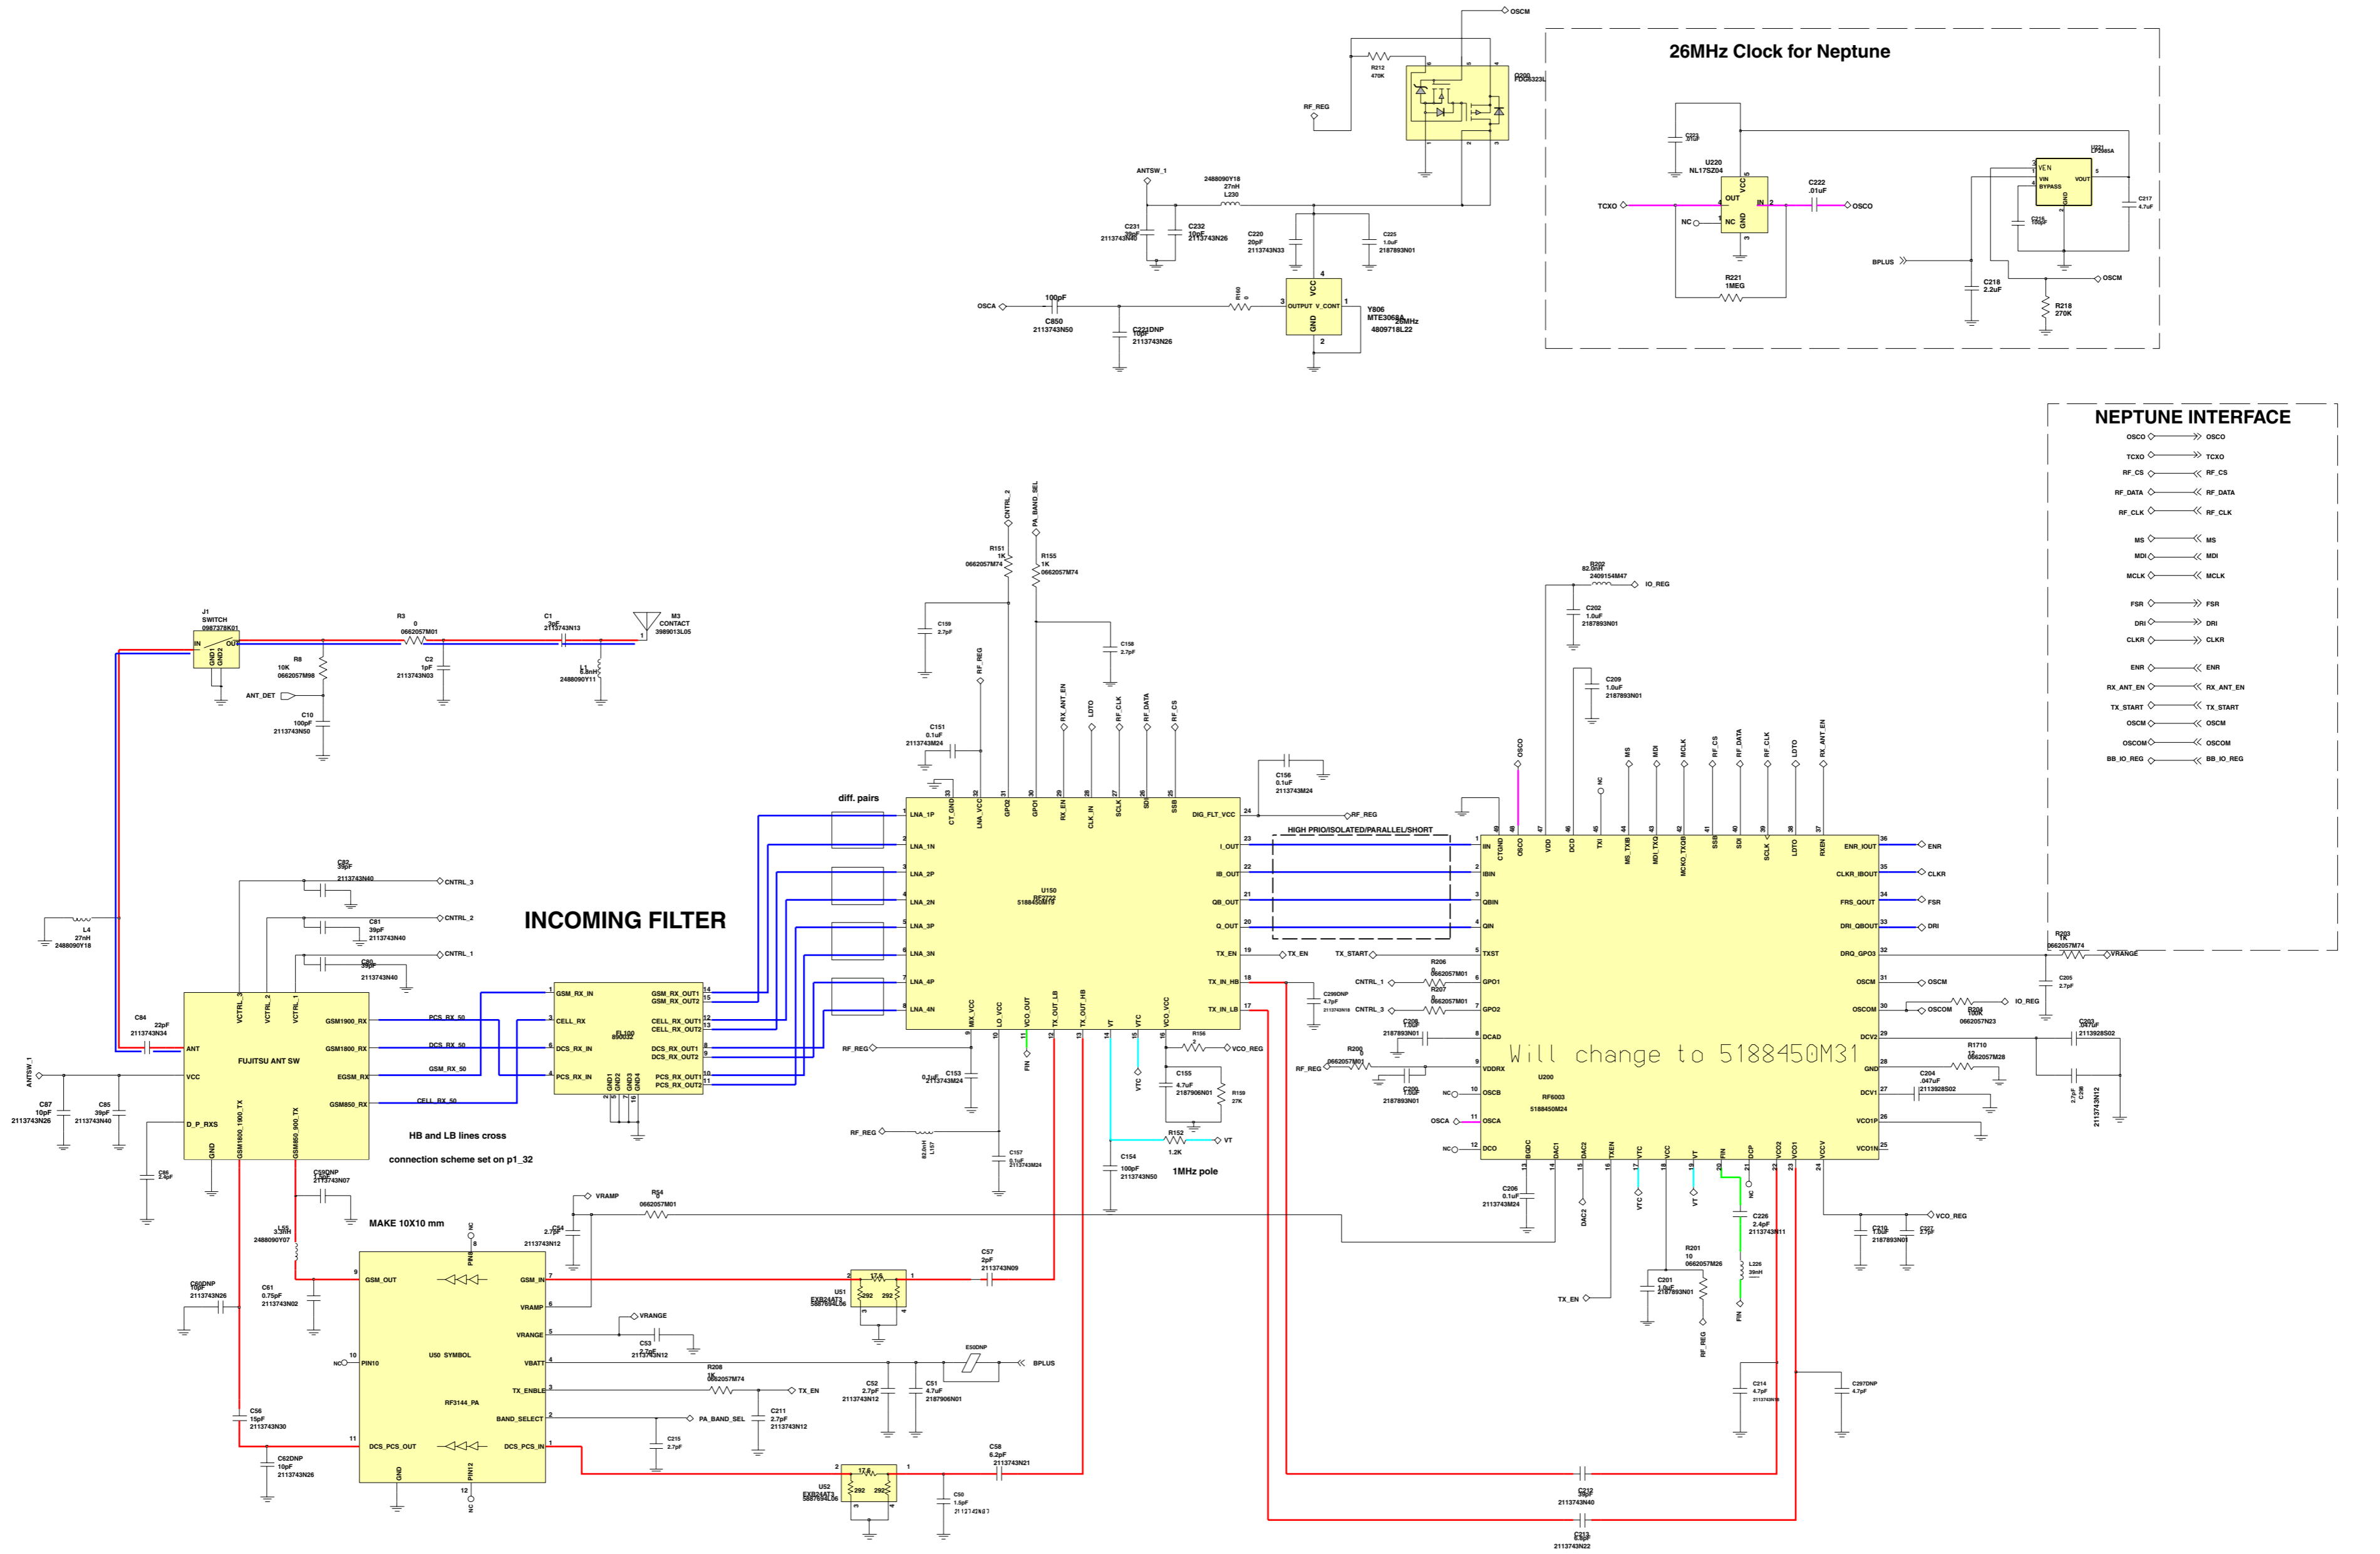

Will change to 5188450M31