

Technical Bulletin

Title

Board units change

Model

GX17

General

According to the change of GX17 board units, its firmware(software) has been also changed. Please perform services according to the following information.

1) Effecton: from May 2006 production

2) Compatibility with Board units and SPST


Board unit	Firmware(software)	Operation
Current	current	○
	new	○
New	current	×
	new	○

3) New Firmware(software)

Destination	Software version
UK, Hungary, Malta, AUS, NZ France, Italy	A41-011-0069-GX17
Greece	A39-011-0070-GX17
Portugal, Spain	A38-011-0068-GX17
Belgium	A24-011-0071-GX17U
South Africa	A29-011-0074-GX17X
Cyprus	A42-011-0072-GX17N

4) How to distinguish new board units from current board units

Point where a moisture sensor attached should be different for new ones and current ones.
Parts code of the board units remain unchanged.

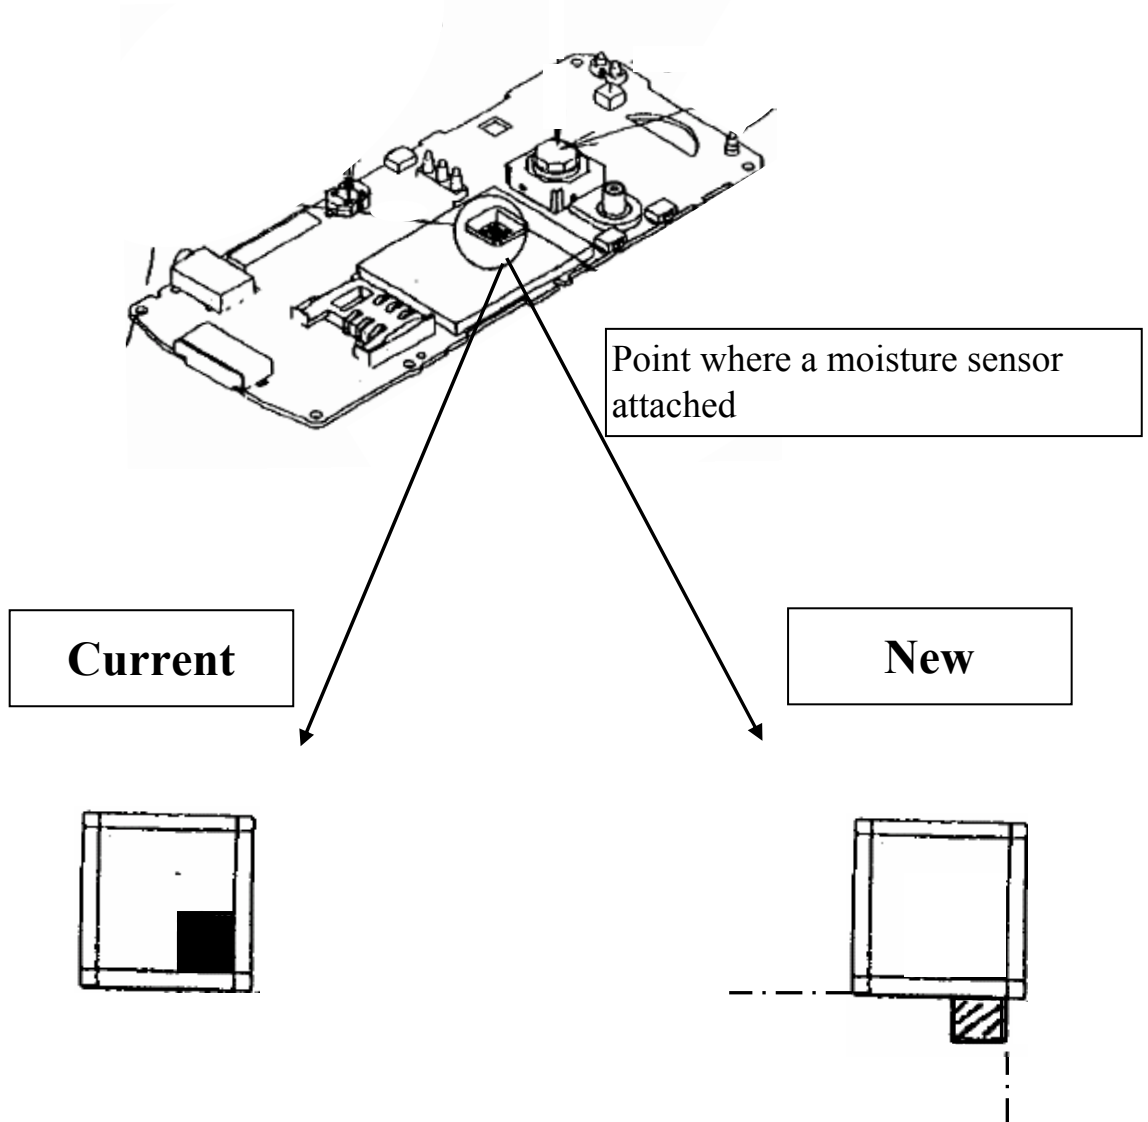

Notice) Board units include keyboards and it is compatible with one another on a unit basis ,
so you are not allowed to exchange only boards or keyboards between old and new board
units.